

Replacing X59 Analog level sensor And X57 Fiber optic cable with glass tip

XT15/XT15I

Service Procedure **X5S012**

RMW 5/08/2024

Note: Follow steps 1-8 for Analog level sensor module (Part # X59) replacement and steps 8-12 for Fiber optic cable with glass tip (Part # X57) replacement.

- 1. Unplug the Instrument.
- 2. Unscrew the four screws located on each side of the cabinet back. Lift the cabinet back while removing it from the instrument.
- 3. Open the electrical box by removing the two screws located on top of the instrument.
- 4. Loosen the two retainer screws using a flat head screwdriver (figure 1)



Figure 1 - Old Model

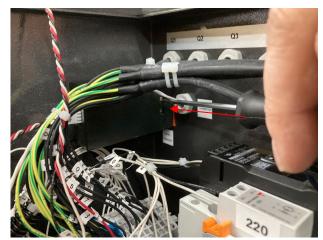


Figure 2 - New Model

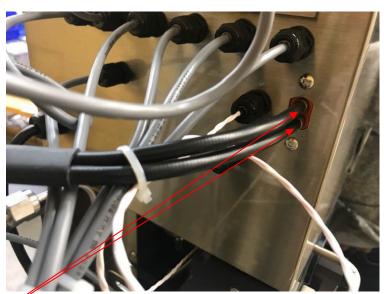


Figure 2

5. Gently pull fiber optic cable from level sensor.



Replacing X59 Analog level sensor And X57 Fiber optic cable with glass tip

XT15/XT15I

Service Procedure **X5S012**

RMW 5/08/2024


6. Detach the wires from the terminal block.

Locate the cables that extends from the Level Sensor and cut any cable ties that bundle it with other cables.

Note: This cable should contain 3 wires #3 Red, #4 Black, #I1 white which attach to a terminal block.

Detach these from the terminal block by inserting and pushing the tip of a flat head screwdriver into the square slot on the terminal block that is next to the wire you desire to remove.

This will release the wire. Note the location from which they were removed.

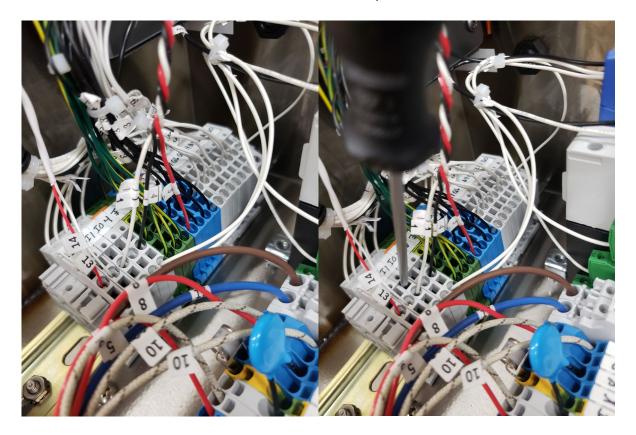





Replacing X59 Analog level sensor And X57 Fiber optic cable with glass tip XT15/XT15I

Service Procedure **X5S012**

RMW 5/08/2024

7. Remove the two 3/32 hex head screws from the back side of the electrical cabinet. This will free the level sensor.

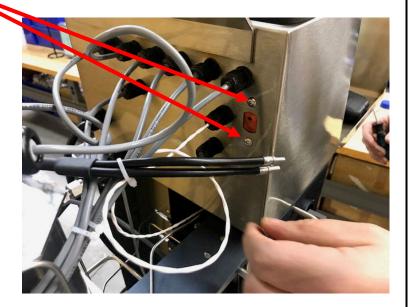

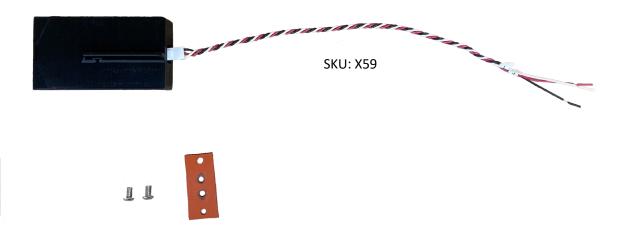

8. To install new Level sensor reverse steps 1-7 **Note**: be sure to reinstall rubber gasket in between level sensor module and electrical cabinet.



Replacing X59 Analog level sensor And X57 Fiber optic cable with glass tip

XT15/XT15I

Service Procedure **X5S012**

RMW 5/08/2024

- 9. To remove fiber optic cable with glass tip cut all cable ties that attach it to other wiring.
- 10. Remove level sensor fitting from the back of the vessel using a 11/16 or adjustable wrench.



- 11. To install new fiber optic cable with glass tip reverse steps 10-8 along with 5.
- 12. Once you have installed the new analog level sensor module and fiber optic cable with glass tip, you are now ready for testing.

VERY IMPORTANT: As soon as there is pressure in the vessel apply a soap solution to all threads on the vessel fitting. Make sure there are no leaks at the fitting or where the cable attaches to the fitting. Contact ANKOM with any questions.